VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

	T		Domestic venicles	
CAMPAIGN No.	2 5 8 0	DATE	Jul.22.2010	
MANUFACTURER	NISSAN			
DESCRIPTION OF DEFECT	Particulate Filter) excessive fuel may be cause the volume of level. If the veh condition, the engine system, and the engine revolution the engine may stall. ② Due to an insufficion on the vehicles we contact point of the turning on the In an extreme case, inoperative even tho ③ Due to an inapproperative expensively the switch is operated lamps may be inoperated in the turned on. ④ Due to an inappropriate the fuel filter, the transmission and	be injected into the f engine oil may of icle continues to be oil can be inhaled ine may be occurred on may be increased. In an extreme of the contact point of the contact point of the contact beautive even though the sate the shape of the cative even though the clearance between the fuel hose might interfere with the contact point of the cont	driven with low load, engine oil. This can exceed the specified be driven in this d into the air intake the white smoke, and In an extreme case, arted. of the hazard switch ide turn lamps, the wear excessively by exwitch is operated. Signal flasher may be h is turned on. the circuit in the es were equipped the ne turn signal switch the electricity when ease, the turn signal switch the turn signal switch the turn signal switch the example.	

ТҮРЕ	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
PDG-EHW41	NISSAN CIVILIAN	1999	482
PDG-EVW41		~	300
PDG-EJW41		2009	93
PDG-ECW41			9
PA-AHW41			1, 206
PA-AVW41			591
PA-AJW41	1		220
PA-ACW41			20
KK-BVW41 KK-BVW41(KAI)			266
KK-BHW41 KK-BHW41 (KAI)			662
UD-DVW41 ABG-DVW41			514
UD-DHW41 ABG-DHW41			501
UD-DJW41 ABG-DJW41			28
UD-DCW41 ABG-DCW41			15
PDG-SEHW41	I SUZU JOURNEY		23
PDG-SEVW41			6
PDG-SEJW41			6
PDG-SECW41			1
KK-SBVW41			5
KK-SBHW41			50
UD-SDVW41			25
UD-SDHW41 ABG-SDHW41			103
UD-SDJW41			5
ABG-SDCW41			1
		TOTAL	5, 132