

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

~~Domestic~~ Import Vehicles

CAMPAIGN No.	2899	DATE	Feb.28.2012
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	<p>①In the glide-slide type door of a route bus, some rotating shafts of the door shafts are eccentric. Therefore, if the door is opened and closed repeatedly with the shaft of such condition, lubrication in the ball joint of the door arm becomes insufficient. And then, the ball joint may have a seizure and in the worst case, the door could not be opened or closed.</p> <p>②In the external switch for opening and closing the door of a route bus, some connections of the switch wiring are improperly water-proofed and thus allow water into the wiring. As such, if the switch is used continuously in this condition, the wiring might corrode and disconnect and in the worst case, it could be impossible to open and close the door with the external switch and the switch on the driver seat for opening and closing the door.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
PJ-KV234L1	HINO Blue Ribbon II	2007	35
PDG-KV234L2		2007~2010	410
PKG-KV234L2			
LKG-KV234L3		2011	2
PJ-KV234N1		2007	31
PDG-KV234N2		2007~2010	325
PKG-KV234N2			
LDG-KV234N3		2010~2011	92
LKG-KV234N3			
		TOTAL	895