

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

CAMPAIGN No.	Gai-1832	DATE	April 18 th 2012
MANUFACTURER	ALPINA Brukard Bovensiepen GmbH+Co.KG (Japanese Importer: Nicole Racing Japan Co.,Ltd)		
DESCRIPTION OF DEFECT	<p>Due to the inappropriate insertion of the plastic lock at the insulating fixation material on battery plus cable under the luggage room floor panel, the fixing of insulating fixation material to the vehicle body may become loose because of influence such as vibration etc.</p> <p>In such case, due to poor contact and insulation failure, power supply to electrical system will not be enough, which may cause engine stall and not possible to restart. And, scorching of luggage room floor panel may occur due to localized temperature increase around battery plus cable caused by discharge between contact points. In worst case, vehicle fire might occur.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ABA-RH12	ALPINA B5	2005 ~ 2007	128
ABA-XH12	B5S	2007 ~ 2009	31
ABA-SH12	ALPINA B5 Touring	2006 ~ 2007	4
ABA-YH12	B5S Touring	2007 ~ 2009	2
ABA-VH12	ALPINA B6 Coupe	2005 ~ 2007	29
ABA-WH12	ALPINA B6 Cabrio	2006 ~ 2007	11
ABA-6H1S	B6S Coupe	2007 ~ 2010	12
	B6S Cabrio	2007 ~ 2010	4
		TOTAL	221