

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	2 9 4 4	DATE	M a y . 2 9 . 2 0 1 2
MANUFACTURER	YAMAHA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	As for the electrical device, due to an inappropriate water-proof structure of the joint connector of the electric wire (main harness), while running in the rain, etc., the water that gets into the electric wire may infiltrate into the engine control unit (ECU) or the terminal section of some of the center actuators. Because of that, a current leakage may be generated among the terminals causing the ECU or some of the center actuators to falsely recognize it. In the worst case scenario, the engine will stop and will not start again. Or the speedometer may possibly give an erroneous indication or the exhaust emission values may go over the standard values.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
E B L - V H 0 2 J	XVS400 DRAGSTAR	2 0 0 9 ~ 2 0 1 2	9 6 0
	XVS400C DRAGSTAR CLASSIC	2 0 0 9 ~ 2 0 1 2	1, 3 8 8
		TOTAL	2, 3 4 8