

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3033	DATE	October. 4, 2012
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	In regard to hydraulic power steering, its supply side may be fitted with rubber piping not adequately resistant to heat, and such rubber piping may lose flexibility due to deterioration by heat of the catalytic converter in the exhaust system, and can crack under fluctuations of hydraulic pressure attendant upon steering. Should this happen, power steering fluid would leak and, if the worse came to the worst, leaked fluid could stick to the exhaust pipe and catch fire.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-RR3	ELYSION	2004~2005	12,945
		2005~2006	3,346
		2006~2008	2,621
		2004~2005	55
		2005~2006	11
		2007~2008	15
DBA-RR4	ELYSION	2004~2005	3,253
		2005~2006	1,098
		2007~2008	705
DBA-RR5	ELYSION PRESTIGE	2006~2008	5,181
DBA-RR6		2006~2008	814
		TOTAL	30,044