

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	3066	DATE	December 19,2012
MANUFACTURER	MITSUBISHI MOTORS CORPORATION		
DESCRIPTION OF DEFECT	<p>In the crank shaft oil seal fitted in the engine front case of the affected vehicles, if the oil seal was replaced with the spare parts which is different material from the one at the time of vehicle production, the retaining force of the subject oil seal may have been decreased due to the combined factors such as the machining variability of the front case and the press fitting variability of the oil seal, etc. Because of this, the subject oil seal would come out and the engine oil would be leaked causing the oil pressure warning lamp to be illuminated, and if use continues under this condition, the inner parts of the engine could be seized resulting in the vehicle unable to be driven.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
V-U41T V-U41TP	MINICAB	1996 TO 1999	25,315	
V-U41V		1996 TO 1999	41,823	
V-U42T V-U42TP		1996 TO 1999	76,995	
V-U42V		1996 TO 1999	23,025	
GD-U61T GD-U61TP		1998 TO 2001	37,793	
GD-U61V		1998 TO 2001	47,682	
GD-U62T GD-U62TP		1998 TO 2001	57,923	
GD-U62V		1998 TO 2001	23,088	
GF-U61W		TOWNBOX	1999 TO 2001	10,319
GF-U62W			1999 TO 2001	7,308
GF-H42A	MINICA TOPPO BJ	1998 TO 2001	274,656	
GD-H42V		1998 TO 2003	133,468	
GF-H47A		1998 TO 2001	52,005	
GD-H47V		1998 TO 2003	11,561	
TA-H42A		2001 TO 2003	26,248	
TA-H47A		2001 TO 2003	5,106	
LE-H42V		MINICA	2002 TO 20003	3,952
LE-H47V			2002 TO 20003	480
UA-H42A	2003 TO 2004		4,949	
UE-H42V	2003 TO 2004		9,673	
UA-H47A	2003 TO 2004		1,131	
UE-H47V	2003 TO 2004		1,337	
CBA-H42A	2004		1,694	
GBD-H42V	2004		2,636	
CBA-H47A	2004		364	
GBD-H47V	2004		351	
LA-H81W	eK-WAGON eK-SPORT eK-CLASSY eK-ACTIVE	2001 TO 2004	250,753	
UA-H81W		2003 TO 2004	84,781	
CBA-H81W		2004	50	
		TOTAL	1,216,466	