KOKU-KU-KI-91

No. TCD-8396-2014

Date of Issue: April 21, 2014

Japan Civil Aviation Bureau

## TAIKUSEI-KAIZEN-TSUHO

## Airworthiness Directive

The undermentioned examinations or modifications are mandatory.

## 1. Applies to: Fuji Model FA-200-160, FA-200-180 and FA-200-180AO

- Compliance is required as indicated, unless already accomplished.
  To prevent the deterioration of brake performance due to seal defects caused by the aged deterioration of O-rings of the brake master cylinders, accomplish the following.
  - 2.1 For aircraft equipped with the brake master cylinders, on the effective date of this AD, if each O-ring has accumulated more than 1000 flight hours or 5 years since the last replacement of the O-ring or if the replacement date of the O-ring cannot be determined, within 50 flight hours or 1 year, whichever occurs first after the effective date of this AD, replace the O-ring in accordance with Fuji Heavy Industries Ltd. Service Bulletin No.200-016 dated April 16, 2014 or any further JCAB-approved revision (herein after referred to as SB).
  - 2.2 From the effective date of this AD, when the brake master cylinder is replaced, check the manufacture date of the brake master cylinder or the last replacement date of the O-ring by referring to component history card or equivalent record.
  - 2.3 During any check as required by paragraph 2.2 of this AD, if it was determined that the O-ring has accumulated more than 5 years since the manufacture date of the brake master cylinder or the last replacement date of the O-ring, or if the manufacture date of the brake master cylinder and the last replacement date of the O-ring cannot be determined, replace the O-ring when installed on the aircraft of the brake master cylinder in accordance with the SB.

Japan Civil Aviation Bureau	No. TCD-8396-2014	sheet 2/2

Τ

2.4 An alternative means of compliance with this AD may be used, if approved by the Director-General of JCAB.

## 3. Remarks

3.1 This AD becomes effective on May 5, 2014.

3.2 Fuji Heavy Industries Ltd. Service Bulletin No.200-016 dated April 16, 2014 and later JCAB approved revisions pertain to this subject.

This is the English translation. In case of any difficulty, refer to the Japanese original text.