## VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

				-		
CAMPAIGN No.	GAI-2202		DATE	June. 25. 2015		
MANUFACTURER	HONDA AUTOMOBILE (THAILAND) CO., LTD.					
DESCRIPTION OF DEFECT	Engine starting system may have been improperly filled with sealant for waterproofing of starter magnetic switch whereby such sealant may enter the terminal to which the starter magnetic switch fuse is assembled. During the course of use, sealant entered the terminal becomes soft and causes decline in contact pressure at the fuse terminal, thereby increasing contact resistance and generating heat. During the course of continued use in such a condition, the fuse-assembled area can suffer meltdown damage and cause poor electrical continuity, when the engine could stall and refuse to restart or the starter magnetic switch circuit could be shirt-circuited, resulting in fire.					
TYPE	COMMERCIAL		MODEL YEAR	NUMBER OF		

TYPE	COMMERCIAL	MODEL YEAR	NUMBER OF
IYPE	NAME	RECALLED	VEHICLE
JBK-MD38	「CRF250L」	2013~2015	2,220
	「CRF250M」	2013~2015	744
JBK-MC43	「CB250F」	$2014 \sim 2015$	1,634
JBK-MF12	「FORZA Si」	$2014 \sim 2015$	1,472
JBK-MC41	「CBR250R」	$2014 \sim 2015$	1,230
EBJ-JC50	「CBR125R」	$2014 \sim 2015$	100
		TOTAL	7,400