Vehicle Safety/Pollution Recall Campaign in Japan

Import Vehicles

Campaign No.	Gai – 2191	Date	June. 10, 2015		
Manufacturer	Jaguar Land Rover Limited (Japanese Importer : Jaguar Land Rover Japan Limited)				
Description of defect	A concern has been identified with the vehicle assembly process where the installation instructions for the Brake Vacuum Hose did not correctly specify its routing. Jaguar Land Rover's continuous review of field reports and warranty data identified loss of brake vacuum assistance on certain vehicles. Further investigations identified the cause of loss of brake vacuum assistance was as a result of chafing of the vacuum hose, which had come into contact with the engine auxiliary drive belt & pulley and worn the vacuum hose through. Further investigations on vehicles in this condition identified that during normal vehicle usage the brake vacuum hose could move towards the engine auxiliary drive belt & pulley and overtime come into contact with the pulley. If the brake vacuum hose contacts the pulley a chafe condition could occur and eventually rupture the brake vacuum hose. This will cause the braking system to loose vacuum assistance from the brake booster and a hard brake pedal will be experienced on the next operation of the brake pedal. If the driver is not aware of this condition it could increase the vehicle's stopping distance.				

Туре	Commercial name	Model year recalled		Number of vehicles
ABA-LG3SB		2013-2014		101
ABA-LGL3SC		2013-2014		1
ABA-LG5NA	「Range Rover」	2013-2014		125
ABA-LG5SA		2013-2014		123
ABA-LGL5SC		2013-2014		2
ABA-LW3SA	[Dance Dayor Crest]	2014-2015		334
ABA-LW5SA	「Range Rover Sport」	2014-2015		55
			Total	741