

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-2283	DATE	December. 17. 2015
MANUFACTURER	Thai Honda Manufacturing Co., Ltd.		
DESCRIPTION OF DEFECT	Engine starting system may have been improperly filled with sealant for waterproofing of starter magnetic switch whereby such sealant may enter the terminal to which the starter magnetic switch fuse is assembled. During the course of use, sealant entered the terminal becomes soft and causes decline in contact pressure at the fuse terminal, thereby increasing contact resistance and generating heat. During the course of continued use in such a condition, the fuse-assembled area can suffer meltdown damage and cause poor electrical continuity, when the engine could stall and refuse to restart or the starter magnetic switch circuit could be short-circuited, resulting in fire.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
JBK-MC41	「CBR250R」	2014	701
JBK-MF12	「FORZA Si」	2014	56
		TOTAL	757