

## VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

|                       |  |      |               |
|-----------------------|--|------|---------------|
| CAMPAIGN No.          | 4015   | DATE | March 31,2017 |
| MANUFACTURER          | Komatsu Ltd.   |      |               |
| DESCRIPTION OF DEFECT | <p>The oil feed pipe for the differential was insufficiently evaluated against travel vibration. As a result, the bracket to support the said oil feed pipe may break because of the travel vibration when tire chains are installed. If the support bracket breaks and the machine is kept used under this condition, the oil feed pipe swings and its base may crack. If this occurs oil leaks and the warning lamp lights. In the worst case, the differential may be seized and the machine may become unable to travel.</p> |      |               |

| TYPE      | COMMERCIAL NAME | MODEL YEAR RECALLED | NUMBER OF VEHICLE |
|-----------|-----------------|---------------------|-------------------|
| YDS-GD032 | 「GD675-6」       | 2015 - 2016         | 77                |
|           |                 | TOTAL               | 77                |