

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4043	DATE	May 18,2017
MANUFACTURER	MITSUBISHI MOTORS CORPORATION		
DESCRIPTION OF DEFECT	<p>Due to inappropriate programming of the engine control and PHEV system control and also due to inappropriate specifications of the spark plugs, the spark plugs may smolder when the vehicle is used repeatedly under EV driving mode in which the vehicle is driven only by the motor with the condition that the engine is operated for a short time period. As a result, the engine may not start when it is necessary due to the smoldering of the spark plug causing the state that the battery is not charged by the engine. If use continues under the EV driving condition, the battery may become lack of electric power resulting in the vehicle unable to be driven.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DLA-GG2W	「OUTLANDER PHEV」	2013~2015	23,179
		TOTAL	23,179