VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

		D	omestic Import Vehicles	
CAMPAIGN No.	Gai-2524	DATE	July. 31. 2017	
MANUFACTURE	BMW (Japanese Importer: BMW Group Japan Corp.)			
DESCRIPTION OF DEFECT	the fixed fork tube of the specified models can be damaged due to unusual incidents with momentary high stress without the user noticing the damage, e.g. through changed drivability. Such high stress can be caused, for example, when driving over an obstacle, during a fall or when driving through deep potholes with unvarying speed. Preliminary damage to the front wheel rim is also not unusual in such cases, but need not be necessarily present. Potential preliminary damage to the fixed fork tube manifests itself through a gap between the tube and the press-fitted, top seal plugs. For the check, the rubber grommet mounted on this position must be pushed down.			

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EBL-R12NA 2BL-R12NA	BMW R1200GS	2014 – 2017	1,715
EBL-R12NA 2BL-R12NA	BMW R1200GS Adventure	2014 – 2017	1,157
		TOTAL	2,872