

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4085	DATE	July. 31. 2017
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	<p>①On certain Heavy- and Medium-duty Route Buses, because of the inadequate protection of the end part of the connecting member for the switch box under the driver's seat and the driver's side wall panel, the said end part and wire may interfere with each other. As a result, the continued use may damage the insulation of the wire to short-circuit, and in the worst case, the engine will be in danger of stopping while the bus is moving and being unable to restart.</p> <p>②On certain Heavy-duty Route Bus, as the harness routing inside the driver side wall panel is inappropriate, the wire may interfere with the end part of the panel bracket. Because of this, the continued use may damage the insulation of the wire to short-circuit, and in the worst case, the door operating mechanism may not function.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
QDG-KV290N1 QKG-KV290N1	[HINO Blue Ribbon]	2015~2017	282
QKG-KV290Q1 QPG-KV290Q1 QRG-KV290Q1		2015~2017	261
SKG-KR290J2	[HINO Rainbow]	2016~2017	142
QSG-HL2ANAP	[HINO Blue Ribbon Hybrid]	2015~2017	53
QSG-HL2ASAP		2015~2017	38
		Total	776