## VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4133	DATE	October.26, 2017	
MANUFACTURER	HONDA MOTOR CO., LTD.			
DESCRIPTION OF DEFECT	For certain fuel tanks, the fuel tank cap's seal efficiency was evaluated improperly and the packing holder assembled to the cap has dimensional inadequacies. If the packing is deformed by fuel, the packing may be dislocated when the cap is closed whereby the seal efficiency may become lower than required. In this case, sudden deceleration while there is much fuel in the tank can cause fuel to leak through the packing seal area and ooze out from the drain tube and, worse still, ingress of water through the seal area into the tank during car washing can lead to malfunction of the engine and/or corrosion of the tank bottom and, while the vehicle continues in service in this condition, such corrosion would advance and could, in the very worst case, result in fuel leakage.			

TYPE	COMMERCIAL	MODEL YEAR	NUMBER OF
	NAME	RECALLED	VEHICLE
2BL-SC77	「CBR1000RR」	2017	539
		TOTAL	539