

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4198	DATE	Feb.14.2018
MANUFACTURER	TOYOTA		
DESCRIPTION OF DEFECT	<p>In the high pressure fuel pump of the subject vehicles, which is mounted on both right and left cylinder banks of the V8 engine, due to resonance of the fuel pressure generated when the fuel is alternately injected by pumps, there is a possibility that the fuel pressure fluctuation could become unexpectedly large, and the fixing portion of the pulsation damper may slide and wear. In this condition, the damper could damage, abnormal noise and/or vibration could occur and, if the vehicle is operated continuously, in the worst case, this could result in fuel leakage.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-USC10	[RC F]	2014-2017	2,204
DBA-URZ100	[LC 500]	2017	1,468
DBA-URL10	[GS F]	2015-2017	1,265
TOTAL			4,937