

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4196	DATE	February 27 .2018
MANUFACTURER	YANMAR CO.,LTD.		
DESCRIPTION OF DEFECT	At electrical wire in agricultural tractor, inappropriately routed ignition switch harness can access accelerator lever mounting part and damage at coat. Operating with that condition eventually brings the damaged part shorted by touching accelerator lever mounting part. In the worst case, coat of accelerator wire might melt due to abnormal heat generated by electric current that run through the wire, then the wire may lose its mobility and engine rotation adjustment might be disabled.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
-	「YT222」	2016	499
	「YT225」	2016	1,129
	「YT225」	2016	49
-	「YT228」	2016	221
	「YT232」	2016	138
	「YT232」	2016	6
TOTAL			2,042