

VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

CAMPAIGN No.	4206	DATE	March 2, 2018
MANUFACTURER	Komatsu Ltd.		
DESCRIPTION OF DEFECT	In some loading machines, the band bolt of the hose between the aftercooler and the engine touches the fuel hose between the fuel filter and the supply pump because of engine vibration, etc., since the hose band is installed incorrectly. Accordingly, the fuel hose cover may be damaged. If the machine is used without modifying this failure, the hose may be torn and the fuel may leak, and in the worst case, a fire breaks out.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDR-WA136	「WA270-8」	2017	42
YDR-WA135	「WA320-8」	2017	18
TOTAL			60