

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic

CAMPAIGN No.	4244	DATE	10/4/2018	
MANUFACTURER	UD Trucks Corporation			
DESCRIPTION OF DEFECT	With regard to Heavy-Duty Trucks and Tractors, due to insufficient fastening torque for the bolts/nuts to secure the spare tire carrier to the vehicle, some of the vehicles may have decreased fastening torque upon which the axial force of the bolt/nut deteriorates. Thus, if the vehicle is operated continuously in this condition, the bolts/nuts might become loose due to vibration occurring during vehicle operation. In the worst case, the bolt/nut might come off after which the spare tire may detach along with the spare tire carrier and may have a risk of interfering with other transportation.			
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
2PG-CD5AL	Quon	2017	5	
2PG-CD5BL	Quon	2017-2018	9	
2PG-CD5CA	Quon	2017-2018	209	
2PG-CG5CA	Quon	2017-2018	589	
2PG-CW5AL	Quon	2017-2018	175	
2PG-CW5BL	Quon	2017-2018	27	
2PG-GK5AAD	Quon	2017-2018	45	
2PG-GK5AAE	Quon	2017	1	
		TOTAL	1,060	