

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	4250	DATE	April 19 ,2018
MANUFACTURER		ISUZU MOTORS LIMITED	
DESCRIPTION OF DEFECT		<p>(1) On certain heavy-duty buses, because the console for the parking brake lever is fixed improperly, if something is put between the console concerned and the driver's seat partition, the console may move, causing the parking brake lever and the console to interfere. Therefore, if the parking brake lever is pulled up, it may be retained before it is properly locked. In the worst case, the lever may be released by the engine vibration etc., resulting the vehicle to start moving.</p> <p>(2) On certain heavy and middle-duty buses, because the fixing structure of the plug on the engine intake pipe is improper, the plug concerned may come out by the internal pressure in high load driving, resulting the engine output to lower while driving and the plug to drop on the road.</p> <p>(3) On certain heavy-duty buses, because the VSC(Vehicle Stability Control) off switch identification display is improper, these vehicles fail to conform to Agreement of Regulation number 121.</p>	

TYPE	COMMERCIAL NAME	MODELYEAR RECALLED	NUMBER OF VEHICLE
QRG-RU1ASCJ QTG-RU1ASCJ	[ISUZU GALA]	2014-2017	1,855
2TG-RU1ASDJ		2017-2018	175
QPG-RU1ESBJ QRG-RU1ESBJ		2014-2017	739
2RG-RU1ESDJ		2017-2018	91
2DG-RU2AHDJ 2KG-RU2AHDJ		2017-2018	33
LDG-RU8JHBJ SDG-RU8JHBJ		2014-2017	386
2DG-RR2AJDJ		[ISUZU GALA MIO]	2017
		TOTAL	3,286