

# VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN No.	Gai-2623	DATE	May 10 <sup>th</sup> , 2018
MANUFACTURER	BMW (Japanese Importer: BMW Group Japan Corp.)		
DESCRIPTION OF DEFECT	Moisture can enter into the crack on the plastic element of the blow-by heater of the engine ventilation, which was caused by inappropriate production. If the crack is expanded by freezing-up, and further moisture enter into the heater element, short circuit may occur followed by overheat of the heater may occur. When keep driving under such condition, warning lamp lights on and in an extreme case, the plastic material may smolder. In worst case, fire in engine compartment or vehicle cannot be excluded.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ABA-UD30	BMW 130i	2007 – 2011	1,353
ABA-UF30		2005 - 2007	953
ABA-VB23	BMW 323i	2005 - 2007	11,413
ABA-VB25	BMW 325Xi	2005 - 2010	4,723
ABA-VF25		2007 - 2010	109
ABA-VB30	BMW 330i	2005 - 2007	297
ABA-VD30	BMW 330Xi	2005 - 2007	93
ABA-VS25	BMW 325i Touring	2005 - 2010	2,925
DBA-FP25	BMW 523i	2010 - 2011	4,172
ABA-NE25	BMW 525i	2005 – 2007	4,450
ABA-NU25		2007 - 2009	5,900
DBA-FR30	BMW 528i	2010 – 2011	4,213
ABA-NE30	BMW 530i	2005 - 2007	1,804
ABA-NU30		2007 -2011	2,161
DBA-MT25	BMW 523i Touring	2010 – 2011	1,658
ABA-NL25	BMW 525i Touring	2005 – 2007	1,443
ABA-PU25		2007 - 2010	2,066
DBA-MU30	BMW 528i Touring	2010 – 2011	956
ABA-NL30	BMW 530i Touring	2005 – 2007	471
ABA-PU30		2007 - 2010	574
ABA-PV30	BMW 530Xi Touring	2007 – 2010	110
ABA-EH30	BMW 630i	2005 – 2010	888
ABA-BU25	BMW Z4 2.5i	2006 – 2008	1,950
ABA-BU30	BMW Z4 3.0si	2006 – 2008	526
ABA-DU30	BMW Z4 Coupe 3.0si	2006 - 2008	683
ABA-LM25	BMW Z4 sDrive 23i	2009 – 2011	2,998
ABA-VL25	BMW X1 xDrive 25i	2010 – 2011	1,664
CBA-WX30	BMW X3 xDrive 28i	2010 – 2011	844
ABA-PC25	BMW X3 2.5Si	2006 – 2010	4,994
ABA-PC30	BMW X3 3.0Si	2006 - 2010	1,042
ABA-FE30	BMW X5 3.0si	2006 – 2010	3,545
		TOTAL	70,978