

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4247	DATE	May 11. 2018
MANUFACTURER	YANMAR AGRIBUSINESS CO.,LTD.		
DESCRIPTION OF DEFECT	<p>① In the engine of agricultural tractor, the shape of joint hose at EGR cooler pipe is inappropriately, cooling water may leak at connecting place. Operating with that condition, water temperature may rise and it may light the warning lamp. In the worst case, the engine may overheat.</p> <p>② In the engine of agricultural tractor, the structure of blow-by gas ventilation system is inappropriately, at driving in low temperature, water in the blow-by gas freezes at the throttle portion of the breather, the route of the blow-by gas is closed, the pressure in cylinder cover is increased. Oil in the turbocharger may be pushed by the pressure and flow in exhaust and intake route. In starting engine, the oil may spout from exhaust pipe and exhaust gas may be not satisfied with emission regulation.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EDR-105B	「EG97」	2011~2012	35
		2011~2012	41
	「EG105」	2011~2012	①138 ②140
		2011~2012	140
TOTAL			①354 ②356