

# VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4274	DATE	May.31, 2018
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>Brake master cylinder may have a secondary cup of inappropriate material and shape. Such a cup may be swollen and deformed by the plasticizer dissolved from the reservoir tank into the brake fluid or by the heat from the running engine. Deformed cup would lose its sealability, and therefore, when the brake pedal is depressed slowly, brake fluid can leak through the sealed area whereby the braking distance could become longer than expected if the worse came to the worst.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-RP1	「STEPWGN」	2015～2017	29,099
DBA-RP2			6,378
DBA-RP3			80,845
DBA-RP4			13,158
DBA-GB5	「FREED」 「FREED+」	2016～2018	70,652
DBA-GB6			8,928
		TOTAL	209,060