

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4293	DATE	Jul. 2. 2018
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	<p>On certain side hanging type spare tire carrier of middle-duty trucks,</p> <p>① due to the improper shape of the hanger, if the spare tire with an aluminum wheel is hung on the carrier, the tire may revolve by the vibration while driving. Therefore, the chain of the carrier may be twisted off, resulting the spare tire to drop.</p> <p>② due to the improper welding of the rolling up equipment, the weld quality may be uneven, causing the safety ratio of the weld strength to be insufficient. Therefore, when the spare tire is hung, if it is tightened with overtorque, not according to the proper tightening method, the welding part may break, resulting the spare tire to drop.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2KG-FC2ABA	[HINO Ranger]	2018	1
		TOTAL	1