

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4333	DATE	Sep.19.2018
MANUFACTURER	TOYOTA		
DESCRIPTION OF DEFECT	In the replacement parts of fuel pump for Liquefied Petroleum Gas vehicles, due to improper tightening of the nut which connect the wire harness to the supply terminal during tightening process, there is a possibility that the wire harness could secure to the terminal with the insufficient tightening force and loose connection. In this condition, the fuel pump could not activated or the terminal could generate heat, and a surrounding seal could damage, resulting in fuel leakage.		

The affected parts shipped as repair parts, and could identify the vehicles equipped with them.

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
DBA-TSS11	[COMFORT]	2011-2012	4	
TOTAL			4	

The affected parts shipped as repair parts, and could not identify the vehicles equipped with them.

PARTS NAME	PARTS NO.	SHIPMENT YEAR	NUMBER OF PARTS	NOTE
Fuel Pump	77020-43030	2018	52	[COMFORT] [CROWN COMFORT] [COMFORT TRAINING VEHICLE] [CROWN SEDAN]
TOTAL			52	