

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	4340	DATE	Oct. 9. 2018
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	<p>①On certain brake systems of medium duty trucks, due to the improper exhaust part structure of the air control valve, when driving on snowy roads, water may adhere to the exhaust part, causing the water frozen and the exhaust part clogged. Therefore, even if the brake pedal is returned, the air may not be emitted and the brake may be dragged, resulting in fire in the worst case.</p> <p>②On certain diesel particulate active reduction system of medium duty trucks, due to the improper fixing method of the fuel line for the fuel addition valve, the piping may be deformed or cracked by the weight of the ice block piled up around the piping when driving on snowy roads. Therefore, the fuel may leak and the diesel particulate active reduction system may not function.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2DG-FC2ABA 2KG-FC2ABA 2KG-FC2ABG 2PG-FC2ABA 2PG-FC2ABG	[HINO Ranger]	2017~2018	6,048
2DG-FD2ABA 2KG-FD2ABA 2KG-FD2ABG 2KG-FD2ABJ 2PG-FD2ABA 2PG-FD2ABG 2PG-FD2ABJ		2017~2018	6,078
QPG-FE2AJAA		2016	3
QPG-FE2AKAA		2016	3
QPG-FE2ALAA QPG-FE2ALAG		2015~2017	43
QPG-FE2AMAA QPG-FE2AMAG		2015~2017	21
QPG-FE2APAA QPG-FE2APAG		2015~2017	44
QPG-FE2AUAA QPG-FE2AUAG		2015~2016	8

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2DG-FE2ABA 2KG-FE2ABA 2KG-FE2ABG 2PG-FE2ABA 2PG-FE2ABG	[HINO Ranger]	2017~2018	1,335
2DG-FJ2ABA 2KG-FJ2ABA 2KG-FJ2ABG 2PG-FJ2ABA 2PG-FJ2ABG		2017~2018	434
2KG-FX2ABA		2017~2018	37
2DG-GC2ABA 2DG-GC2ABG 2KG-GC2ABA 2KG-GC2ABG 2PG-GC2ABA 2PG-GC2ABG		2017~2018	476
2DG-GD2ABA 2KG-GD2ABA 2KG-GD2ABG 2PG-GD2ABA 2PG-GD2ABG		2017~2018	484
2KG-GX2ABA 2PG-GX2ABA		2017~2018	270
		TOTAL	15,284