

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN NO.	4349	DATE	Oct. 25, 2018
MANUFACTURER	MITSUBISHI MAHINDRA AGRICULTURAL MACHINERY CO.,LTD.		
DESCRIPTION OF DEFECT	<p>① On the motor of the agricultural tractor, a gap may be formed between the engine rear plate and the clutch housing by repeating engine start due to improper installation of the starter motor. Therefore, the pinion gear of the starter motor and the engine flywheel do not engage. In the worst case, there is a risk that the engine does not start.</p> <p>② On the motor of the agricultural tractor, the terminal part may crack during processing or attachment because the ST terminal has poor strength and is different from the original designed one. Therefore, if operating the tractor under this situation continuous and the terminal part is damaged, there is a risk that the engine does not get started.</p>		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDM-GT36D	「GM300」	2016-2018	① 62 ② 57
	「GM300H」	2016-2018	① 22 ② 22
	「GM330」	2016-2018	① 128 ② 125
	「GM330H」	2016-2017	① 34 ② 37
	「GM360」	2016-2018	① 57 ② 54
	「GM360H」	2016-2018	① 61 ② 62
YDM-GT36E	「GA300」	2016-2017	28
	「GA300H」	2016-2016	10
	「GA330」	2016-2017	37
	「GA330H」	2016-2017	19
	「GA360」	2016-2018	40
	「GA360H」	2016-2017	56
	「GAK330」	2017-2017	10
「GAK360」	2016-2017	29	
		TOTAL	① 364 ② 586