

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4365	DATE	Oct. 30.2018	
MANUFACTURER	UD Trucks Corporation			
DESCRIPTION OF DEFECT	<p>With regards to the cooling device for heavy-duty-all-wheel-drive vehicles, because the tightening method applied to the stud bolt which fastens the fan hub and the radiator cooling fan was not the proper method, the stud bolt insertion port of the fan hub may crack and loosen. This may lead to the rotation of the radiator cooling fan to be deflected and cause excessive stress and damage on the water pump housing fixing part of the fan hub. In such case, the fan hub may detach towards the radiator side together with the cooling fan, and in the worst case, the radiator core may be damaged and cause coolant water leakage which may lead the vehicle to be inoperable, or parts of the damaged water pump housing may drop off on the road.</p>			
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
2DG-CF5AL	Quon	2018	2	
2DG-CZ5BL	Quon	2018	29	
		TOTAL	31	