

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN No.	Gai-2776	DATE	February 12 th , 2019
MANUFACTURER	BMW (Japanese Importer: BMW Group Japan Corp.)		
DESCRIPTION OF DEFECT	<p>① Due to inappropriate mounting of fuel pump in the fuel tank, the fuel level sensor might touch the feed line. In this case, the fuel level might be displayed incorrectly, which could lead to engine stalling by running out of gas.</p> <p>② The software of the engine control unit (DME), which is controlling the fuel pressure, is not appropriate. Thus, fuel pressure drops, which could lead to insufficient fuel supply with warning light on, and in worst case the engine might stall while driving.</p> <p>③ Due to inappropriate mounting of high pressure pump, the pump might detach from the flange. As a result, fuel line might become leaky. Subsequently, the fuel pressure might drop, fuel supply might be insufficient, and in worst case the engine might stall while driving.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ABA-JF44M	BMW M5	2017 - 2018	169
		TOTAL	169