

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4439	DATE	Feb.28, 2019
MANUFACTURER	SUBARU CORPORATION		
DESCRIPTION OF DEFECT	Due to the improper contact point structure of the stop light switch, conduction failure may occur by the influence of silicone gas, which is volatilized from car interior cleaning utensils, cosmetics, or any other silicone-containing products and creates insulating film on the contact point. Therefore, stop light may not be illuminated, and sideslip prevention device warning lamp may be turned on and/or engine may not start.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-GE2	「IMPREZA」	2008 ~ 2011	3,242
DBA-GE3		2008 ~ 2011	3,640
DBA-GE6		2008 ~ 2011	1,176
DBA-GE7		2008 ~ 2011	1,727
CBA-GVB		2010 ~ 2014	6,145
CBA-GVF		2010 ~ 2014	4,179
DBA-GJ2		2011 ~ 2016	5,838
DBA-GJ3		2011 ~ 2016	9,281
DBA-GJ6		2011 ~ 2016	3,555
DBA-GJ7		2011 ~ 2016	16,050
DBA-GP2		2011 ~ 2016	25,591
DBA-GP3		2011 ~ 2016	25,298
DBA-GP6		2011 ~ 2016	9,850
DBA-GP7		2011 ~ 2016	107,990
DBA-SJ5	「FORESTER」	2012 ~ 2015	59,394
DBA-SJG		2012 ~ 2015	23,772
		TOTAL	306,728