

Vehicle Safety/Pollution Recall Campaign in Japan

Import Vehicles

Campaign No.	Gai – 2799	Date	March, 15, 2019
Manufacturer	Jaguar Land Rover Limited (Japanese Importer : Jaguar Land Rover Japan Limited)		
Description of defect	<p>A concern has been identified on certain Range Rover, Range Rover Sport, Range Rover Velar and Discovery vehicles fitted with V6 and V8 petrol engines, where the crankshaft pulley retaining bolt may fracture. A batch of bolts has been manufactured away from specification and therefore has the potential to develop cracks on the surface of the bolt leading to hydrogen embrittlement. These cracks cause the bolt to fracture over time leading to a loss of retention of the crankshaft pulley. Where bolt fracture occurs, the pulley will oscillate for a period but ultimately, the crankshaft nose will break leading to engine failure.</p>		

Type	Commercial name	Model year recalled	Number of vehicles
ABA-LG5SA	「Range Rover」	2019	5
ABA-LGL5SC	「Range Rover」	2019	2
ABA-LW3SA	「Range Rover Sport」	2019	1
ABA-LW5SA	「Range Rover Sport」	2019	4
ABA-LR3VA	「Discovery Sport」	2019	2
CBA-LY3VA	「Range Rover Velar」	2019	14
Total			28