VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4488	DATE	April 18, 2019	
MANUFACTURER	HONDA MOTOR CO., LTD.			
DESCRIPTION OF DEFECT	Electric water pump for cooling the fuel cell system may, because of inadequate surface treatment of the drive motor magnet, suffer corrosion of the magnet by cooling water. Such corrosion will advance while the vehicle continues in service, rendering the electric water pump inoperative. Should this happen, the warning light/indicator would come on while the power mode is on and the fuel cell system might be rendered unstartable, or the warning light/indicator would come on while the vehicle is driving and the fuel cell system might be shut off, and as the worst consequence the vehicle could be disabled.			

TYPE	COMMERCIAL	MODEL YEAR	NUMBER OF
	NAME	RECALLED	VEHICLE
ZBA-ZC4	「CLARITY」	2015~2018	218
		TOTAL	218