

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic vehicles

CAMPAIGN No.	4492	DATE	April 23, 2019	
MANUFACTURER	UD Trucks Corporation			
DESCRIPTION OF DEFECT	With regards to the brake caliper for front and rear wheels, because of an inappropriate press fitting method for the automatic adjuster drive pin in the brake caliper, some of the drive pins may become damaged due to repetitive braking operations. Thus, in the event of the brake pad wear and tear, although the wear is progressed, the clearance between the brake pad and the brake disc will not be adjusted automatically, which may lead to service and parking brake function deterioration.			
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
2PG-CD4BA	QUON	2018	1	
2PG-CD4CA		2018	1	
2PG-CD5AL		2018	2	
2PG-CD5BA		2018	1	
2PG-CD5BL 2PG-CD5BLKai		2018	3	
2PG-CD5CA		2018	35	
2PG-CD5CE		2018	6	
2PG-CD5CL		2018	6	
2PG-CW4AL		2018	1	
2PG-CW5AL		2018	22	
2PG-CW5BL		2018	3	
2PG-CW5CA		2018	1	
2PG-CW5CL		2018	3	
2PG-CX5BA		2018	3	
2PG-GK5AAB		2018	61	
2PG-GK5AAD		2018	17	
2PG-GK5AAE		2018	7	
		TOTAL	173	