

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	Gai-2840	DATE	March 23. 2019	
MANUFACTURER	Volvo Truck Corporation (Japanese Importer : UD Trucks Corporation)			
DESCRIPTION OF DEFECT	With regards to the brake caliper for front and rear wheels, because of an inappropriate press fitting method for the automatic adjuster drive pin in the brake caliper, some of the drive pins may become damaged due to repetitive braking operations. Thus, in the event of the brake pad wear and tear, although the wear is progressed, the clearance between the brake pad and the brake disc will not be adjusted automatically, which may lead to service and parking brake function deterioration.			
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
2DG-KA2TDA1	FH	2018	5	
2DG-KA2TEA1		2018	4	
2DG-KA4TBA1		2018	4	
		TOTAL	13	