

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4515	DATE	June 27, 2019
MANUFACTURER	Mazda Motor Corporation		
DESCRIPTION OF DEFECT	In the affected engine control module, due to the inappropriate control program of the cylinder deactivation function, the valve clearance adjuster may operate improperly when reactivating the deactivated cylinders while driving. Accordingly, the rocker arm may fall and make contact with the surrounding parts, which may cause an engine misfire and loss of power. In the worst case, the engine may stall.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
6BA-KF5P	Mazda「CX-5」	2018-2019	7,077
6BA-GJ5FP	Mazda「Atenza」	2018-2019	1,172
6BA-GJ5FW		2018-2019	751
		Total	9,000