

VEHICLE SAFETY RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4531	DATE	July 10 , 2019
MANUFACTURER	SUZUKI MOTOR CORPORATION		
DESCRIPTION OF DEFECT	<p>Some of the fuel hoses may have insufficient elasticity, due to improper control in the molding process.</p> <p>Therefore, the fuel hose may deform by the heat and the vibration from the engine and it may come contact with the steering shaft.</p> <p>In the worst case, the hose may be damaged and it may leak the fuel..</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
3BA-JB64W	JIMNY	2018~2019	21,248
		TOTAL	21,248