

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4542	DATE	July.24.2019
MANUFACTURER	TOYOTA		
DESCRIPTION OF DEFECT	In a brake booster pump of an electrical control brake, due to an improper manufacturing machine of the resin brush holder which is a component part of pump motor, the gap between a brush and the brush holder is small. When the pump operates, the holder thermally expands and the brush can't move resulting in conduction failure of pump motor. If this were to occur, the pump motor doesn't operate and warning light illuminates, and in the worst case, loss of braking assist while driving could increase the vehicle stopping distance.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
DAA-ZVW51 DAA-ZVW55	[PRIUS]	2019	9,604	
DLA-ZVW52	[PRIUS PHV]		809	
DAA-ZYX10	[C-HR]		2,436	
6AA-AXAH52 6AA-AXAH54	[RAV4]		2,331	
DAA-AXVH70	[CAMRY]		2,028	
6AA-ZWE211H	[COROLLA SPORT]		1,751	
6AA-AZSH20 6AA-AZSH21 6AA-GWS224	[CROWN]		1,405	
DAA-NTP10	[JPN TAXI]		531	
6AA-MZAH10 6AA-MZAH15	[UX250h]		714	

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
6AA-AXZH10	[ES300h]	2019	702	
DBA-VXFA50 DBA-VXFA55	[LS500]		67	EXECUTIVE Version L F SPORTS I package
DAA-GVF50 DAA-GVF55	[LS500h]		48	
DAA-AXVH70N	[ALTIS]		5	
		TOTAL	22,431	

The affected parts shipped as repair parts, and could not identify the vehicles equipped with them.

PARTS NAME	PARTS NO.	SHIPMENT YEAR	NUMBER OF PARTS	NOTE
Brake Booster Pump	47070-50080	2019	66	[CROWN] [LS500] [LS500h]
	47070-47100		5	[PRIUS] [PRIUS PHV] [C-HR] [COROLLA SPORT] [UX250h]
	47070-33080		1	[CAMRY] [ALTIS] [ES300h]
	47070-15020		1	[JPN TAXI]
		TOTAL	73	