

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN No.	Gai-2905	DATE	August 28 th , 2019
MANUFACTURER	BMW (Japanese Importer: BMW Group Japan Corp.)		
DESCRIPTION OF DEFECT	Due to an insufficient manufacturing process, oil residue might be possible on the nuts, with which the left and right tail lights are attached to the vehicle body. This could cause damage on the tail light holder. As a result, the tail light could become shaky, which would not comply with the Japanese safety regulation.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-1R15	BMW 118i	2018	268
LDA-1S20	BMW 118d	2018	255
DBA-1S30	BMW M140i	2018	8
DBA-2F20	BMW 220i	2018	19
DBA-2G30	BMW M240i	2018	4
CBA-2U30	BMW M2 Competition	2018	108
DBA-6S15	BMW 218i Active Tourer	2018	47
LDA-2C20	BMW 218d ActiveTourer	2018	127
DBA-6V15	BMW 218i Gran Tourer	2018	1
LDA-2E20	BMW 218d GranTourer	2018	54
DLA-2C15	BMW 225xe ActiveTourer	2018	4
CBA-3C30	BMW M3	2018	1
DBA-8E15	BMW 318i	2018	63
LDA-8C20	BMW 320d	2018	93
DBA-8A20	BMW 320i	2018	54
	BMW 330i	2018	1
DBA-7A30	BMW 740i	2018	4
LDA-7C30	BMW 740d xDrive	2018	1
DLA-7D20	BMW 740e iPerfomance	2018	2
CBA-7A44	BMW 750i	2018	1
DBA-7E30	BMW 740Li	2018	1
DBA-YH15	BMW X2 sDrive 18i	2018 - 2019	511
LDA-YK20	BMW X2 xDrive 18d	2018 - 2019	271
ABA-YH20	BMW X2 xDrive 20i	2018 - 2019	352
3BA-YN20	BMW X2 M35i	2018 - 2019	138
DBA-TR20	BMW X3 xDrive20i	2018	2
LDA-TX20	BMW X3 xDrive 20d	2018	23
LDA-TX30	BMW X3 M40d	2018	2
		TOTAL	2,415