

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4584	DATE	October 17, 2019	
MANUFACTURER	UD Trucks Corporation			
DESCRIPTION OF DEFECT	<p>With regards to the coolant device for low-floor-front-dual-axle-heavy-duty-trucks, improper fitting of the radiator lower hose may cause insufficient clearance between the radiator lower hose and the engine under cover. When the radiator lower hose expands during vehicle usage, the engine under-cover vibration generated upon engine idling, may lead to hose and cover interference. Consequently, leading to the damaged hose. If the vehicle continues to operate under these conditions, the hose may crack and cause coolant water leakage. In the worst case the vehicle might become over heated.</p>			
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
LKG-CG5YE QKG-CG5YE	Quon	2010 - 2017	20	
LDG-CG5ZE LKG-CG5ZE QDG-CG5ZE QKG-CG5ZE QPG-CG5ZE		2010 - 2017	1,055	
		TOTAL	1,075	