

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	4622	DATE	December 12, 2019
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>(1) Electric parking brake may have a problem that the actuator has a motor wire connection with inadequately crimped solderless terminal or the motor commutator and brush were faultily manufactured. In this case, temporary increase of the motor internal contact resistance due to running vibrations may disturb the signal to detect disconnection of the motor circuit. Should this happen, the VSA could detect it as a fault, causing the warning light and indicator to come on and rendering the parking brake inoperative or unreleasable.</p> <p>(2) Electric parking brake may have a problem that the spring package to expand and contract drum brake shoes has a fault in its operation stroke setting. In this case, the spring package may interfere with the shoe spreader body when the parking brake is released, whereby the motor load can be increased. Should this happen, the motor current value would exceed its threshold level and the VSA could detect it as a fault, causing the warning light and indicator to come on and rendering the parking brake inoperative.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
6BA-JH3	「N-WGN」	2019	7,698
6BA-JH4	「N-WGN Custom」		1,739
		TOTAL	9,437