

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	5435	DATE	26. Jan. 2024
MANUFACTURER	YAMAHA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	The molding conditions of the impeller (vanes made of resin) of the fuel pump, which is used as the replacement repair parts, were unsuitable. As the results, the density of the resin became low, and the impeller may become swollen and deformed due to fuel. This causes the impeller to contact the fuel pump cover and causes malfunctions of the fuel pump, and in the worst case, the engine may stall while the vehicle is running.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
EBL-RP17J	XJR1300	2006~2007	3
TOTAL			3

Something shipped as a replacement repair part and for which the assembled vehicle cannot be identified.

PART NAME	PART NUMBER	MODEL YEAR PART	NUMBER OF PART
FUEL PUMP ASSEMBLY	5UX-13907-10	2017~2019	42
	5UX-13907-11	2019~2020	47
	2D1-13907-02	2017~2019	37
	2D1-13907-03	2019~2020	27
	5YU-13907-05	2017~2019	16
	5YU-13907-06	2019~2020	18
	2C0-13907-01	2017~2019	5
	2C0-13907-02	2019~2020	7
	3D8-13907-01	2018	4
	3D8-13907-02	2019~2020	6
TOTAL			209

Vehicles with replacement repair parts assembled shall be subject to the same improvement.