

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	2505	DATE	April 8 ,2010
MANUFACTURER	ISUZU MOTORS LIMITED		
DESCRIPTION OF DEFECT	<p>In the CNG-fueled vehicles, it has been found that:</p> <p>(1) the fuel fill method at the assembly plant was inappropriate, considering materials of the fuel tank safety valves, so that cracks might occur inside the safety valve: thus, if they are used as are, cracks will advance and eventually lead to fuel leak, and</p> <p>(2) the mechanical automatic transmission control unit program was inadequate, thereby rendering the gearshift operation inoperative: thus, the gearshift lever position and the gear position displayed in the gear position indicating lamp may be different from the actual gear position.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
NFG-NJR82AN	ELF	2007-2009	73
NFG-NKR82XAN		2007-2009	101
NFG-NLR82AN NFG-NLR82N		2007-2009	192
NFG-NMR82AN NFG-NMR82N		2007-2009	703
PDG-NPR75N(kai)		2007	3
NFG-NPR82XAN NFG-NPR82XN		2007-2009	1,326
NFG-AJR82AN		ATLAS	2008-2009
NFG-AKR82XAN	2008-2009		5
NFG-ALR82AN	2008		1
NFG-AMR82AN	2009		3
NFG-APR82XAN NFG-APR82XN	2008-2009		2
NFG-BJR82AN	CONDOR		2008
NFG-BKR82XAN		2007-2008	3
NFG-BMR82AN NFG-BMR82N		2008-2009	8
NFG-BPR82XAN NFG-BPR82XN		2007-2009	21
NFG-LJR82AN		TITAN	2008
NFG-LMR82AN	2007-2008		8
NFG-LPR82XAN	2007-2009		3
		TOTAL	2,458