

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	2503	DATE	April 15, 2010
MANUFACTURE	Mazda Motor Corporation		
DESCRIPTION OF DEFECT	Due to improper configuration of guide on radiator shroud panel to prevent radiator from being damaged during assembly process, the guide touches automatic transmission oil hose. As a result, when the vehicle is used to drive on bad roads like unpaved roads for the long term, the hose may wear out. In the worst case, oil may leak out and MIL may illuminate, and there's a possibility that the vehicle may no longer drive.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-BK5P	Mazda AXELA	2006-2009	35,181
		Total	35,181