

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-1665	DATE	May 20,2010
MANUFACTURER	Mitsubishi Motors(Thailand)Co., Ltd.		
DESCRIPTION OF DEFECT	<p>SINCE THE POSITION CONTROL OF THE TWO SHEET METALS FOR THE UPPER ARM IN THE FRONT SUSPENSION IS INAPPROPRIATE WHEN WELDING, THE POSITION OF THE MOUNTING HOLE IN THE SHEET METAL TO INSTALL THE UPPER ARM BALL JOINT HAS BEEN MISALIGNED. DUE TO THIS CONDITION, THE MOUNTING BOLT MAY NOT BE TIGHTENED WITH SUFFICIENT TIGHTENING FORCE CAUSING THE BOLT TO BE LOOSENED IN USE AND THE BALL JOINT TO BE DETACHED RESULTING IN THE VEHICLE UNABLE TO BE DRIVEN.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ABF-KB9T	TRITON	2006 TO 2009	1,085
		TOTAL	1,085