VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN NO.	2536	DATE	May 26 ,2010
MANUFACTURER		ISUZU BODY CORPORATION	
DESCRIPTION OF DEFECT		In the engines of the vehicles additionally equipped with the electric generator, the installation strength of the bracket for the idle pulley for the electric generator driving belt is so insufficient that the mating face of the idle pulley bracket and the electric generator bracket will be abraded due to belt tensile force, electric generator driving force, etc. Thus, if they are used as are, the brakcet mounting bolts will be broken, and in the worst case, the pulley and the bracket may come off and obstruct other traffic.	

ТҮРЕ	COMMERCIAL NAME	MODELYEAR RECALLED	NUMBER OF VEHICLE
PJ-CYL77V6		2006	2
PDG-CYL77V8		2007 - 2009	9
PDG-CYL77V8A	GIGA	2008	1
PDG-CYZ77P8		2007 - 2009	6
PDG-CYL77T8		2010	1
		TOTAL	19