

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	2547	DATE	May. 31. 2010
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>(1)The clip with which the speedometer cable is secured may have been staked inadequately and can fail to hold the cable in place when the suspension expands and contracts. In this case, the cable can come off the clip and could be, with the handlebar turned counterclockwise to full lock while parking, caught in the handlebar stopper and broken, rendering the speedometer inoperative.</p> <p>(2)The rear wheel brake light switch may be housed in a switch case that has been molded improperly, and the internal moving contact can thereby be allowed to move beyond its operating range and could be stuck there, causing the brake light to stay on. Continued use in such a condition can damage the bulb socket of the brake light, resulting in brake light failure due to poor continuity.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
EBJ-JA07	SUPER CUB 110	2009	2,580	(2)
	SUPER CUB 110P	2009	1	(2)
	SUPER CUB 110PRO	2009~2010	1,491	(1)1,491 (2)903
	SUPER CUB 110MD	2009~2010	11,564	(1)11,564 (2)6,957
		TOTAL	15,636	(1)13,055 (2)10,441