

**VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN**

**Domestic Vehicles**

<b>CAMPAIGN No.</b>	2544	<b>DATE</b>	JUNE.2, 2010
<b>MANUFACTURER</b>	SUZUKI MOTOR CORPORATION		
<b>DESCRIPTION OF DEFECT</b>	<p>Camshaft drive chain may be worn and stretched by water accumulation in engine oil which is created especially in repeated short time runs in cold conditions, by engine blow-by gas dew condensation due to slow engine temperature increase. When engine is kept running in this condition, cam chain noise will be generated. In the worst case, there is a possibility of chain dislocation, engine stalling and no engine restarting.</p>		

<b>TYPE</b>	<b>COMMERCIAL NAME</b>	<b>MODEL YEAR RECALLED</b>	<b>NUMBER OF VEHICLE</b>
BA-CJ44A	SKYWAVE	2007	10,864
JBK-CJ45A	SKYWAVE	2007	5,056
JBK-CJ46A	SKYWAVE	2008	2,728
		<b>TOTAL</b>	<b>18,648</b>