

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	2539	DATE	Jun. 17, 2010
MANUFACTURER	FUJI HEAVY INDUSTRIES LTD.		
DESCRIPTION OF DEFECT	On oil cooler hose of Continuously Variable Transmission (CVT), certain hoses may have been crinkled on inner surface due to improper work during manufacturing process of the hose. Under these circumstances, crack may develop from inner surface to outer with the origin of the hose crinkles if it was continuously used, which will possibly result in oil leak and incapable driving in the worst scenario.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-BM9	Legacy	2009	1,657
DBA-BR9		2009	5,969
		TOTAL	7,626