VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestie / Import Vehicles

CAMPAIGN No.	GAI-1706	DATE	October 21, 2010	
MANUFACTURER	Audi AG			
	(Japanese Importer : Audi Japan KK)			
	Concerning the headlight integrated with positioning light, the positioning light may			
	not turn on because of incorrect sealing material for back cover of lighting device.			
	This sealing material vaporizes and its component causes contact point of electrical			
DESCRIPTION OF	substrate for positioning light (LED) to corrode and results poor electrical contact. The			
DEFECT	non operation is displayed to the driver.			
	The manufacturing date of both right and left headlights integrated with positioning			
	light will be checked on all vehicles. If the headlight is affected, replace the light with			
	modified one.			

ТҮРЕ	COMMERCIAL	MODEL YEAR	NUMBER OF
	NAME	RECALLED	VEHICLES
ABA-4FBUHS		2008	150
	RS6 / RS6 Avant	2009	137
		2010	8
ABA-4FCAJA	AC20 TESI questing / ACAugust 20 TESI questing	2009	108
	A6 3.0 TFSI quattro / A6 Avant 3.0 TFSI quattro	2010	16
ABA-4FCAJS	AC20 TESI questions / AC Amont 20 TESI question	2009	166
	A6 3.0 TFSI quattro / A6 Avant 3.0 TFSI quattro	2010	37
ABA-4FCCES	AC 2.9 ESI questions / AC Amont 2.9 ESI questions	2009	190
	A6 2.8 FSI quattro / A6 Avant 2.8 FSI quattro	2010	5
		TOTAL	817