

## VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

(Domestic) / Import Vehicles

CAMPAIGN No.	2648	DATE	10, November, 2010
MANUFACTURER	Kobelco Construction Machinery Co., Ltd.		
DESCRIPTION OF DEFECT	Roof of Canopy is located over the operator and installed at Roof Stay by tightening Bolts. Because no Plain Washers are placed on installation Bolts which tighten Roof Frame of Roof and Support Stay, the seating surface of Bolt will be yielded due to the contact pressure by excessive tightening force or the vibration condition while the machine is working, resulting Bolts loosening. At worst case, Bolts will be possible to break or drop off so that Roof will fall down finally.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
SA-RW03	LK40Z	2004 ~ 2007	123
SA-RX03	LK50Z	2004 ~ 2007	82
TOTAL			205